


📅 THURSDAY, OCTOBER 14, 2021

Deck/Surface/Equipment

Description of deck and surface.

Deck: Tile Surface:blue gem Picture of pool equipment.

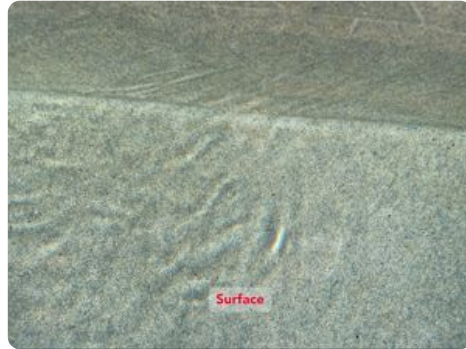

Test - Pressure Test - Leak Detection

Pressure tested all lines. All lines appear to be holding solid.



Pool - Skimmer - Throat

Found leak in skimmer throat where the plastic skimmer butts up to the cement pool shell. Area had been previously epoxied and the deterioration is now severe and over a quarter inch wide in some areas. Tried to Patch with epoxy but patch kept pulling into the gap. I do not expect this to hold. Expect minimal water loss until repairs are completed. Recommend skimmer throat rebuild. Using surface to replace the inner tiles as we will not be able to match the current tiles and using surface is the better repair.



Test - Complete Dye Test

Performed a complete dye test in the pool.

Pool - Sheer Descent (unable to test)

The sheer descent(s) CANNOT be tested because there is no way to plug off it's long, narrow opening.



Leak Status - Minimal Water Loss

Minimal water loss should be expected until repairs are completed.

Miscellaneous

Surface is showing signs of deterioration.



Problems - Light (unable to determine if it works)

Unable to determine if the light is working. The light switch was either not found or inaccessible.

