


📅 TUESDAY, OCTOBER 12, 2021

## Deck/Surface/Equipment

Description of deck and surface. equipment.

Deck:

PaversSurface:aqua gem Picture of pool

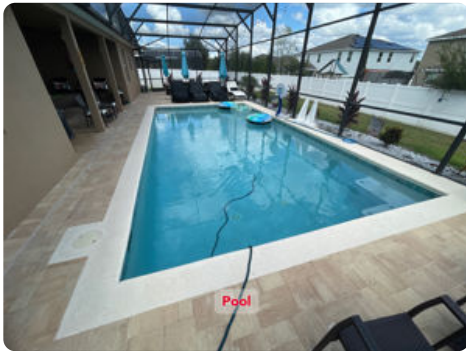

## Equipment - Filter

Found leak coming out of filter when pump is running. &nbsp;  Filter needs to be serviced. &nbsp;  



## Leak Status - Equipment Leak

The equipment will leak, as identified in the findings, until it is fixed by a pool service professional.&nbsp;

---

## Leak Status - Leaking

The pool will continue to leak at the same rate until repairs are completed.

---


## Pool - Main Drain - Sump (crack)

Found leak in cracked pool main drain sump. Needs to be replaced.&nbsp;



## Pool - Skimmer - Throat


Found leak in skimmer throat where the plastic skimmer butts up to the cement pool shell. Patched with epoxy. Recommend proper repair.

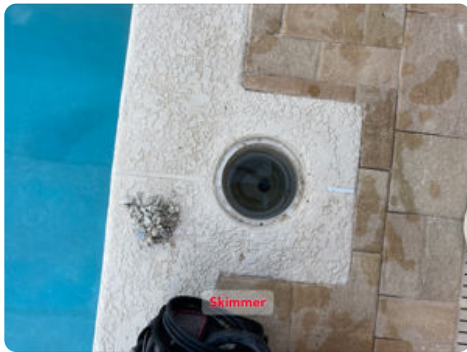

---

## Epoxy - Item Previously Epoxied

Found existing epoxy patch (in/around) (skimmer throat). Epoxy patches are an indication of previous leaks that could open up in the future as the patch wears away, initiating further water loss. Recommend proper repair.

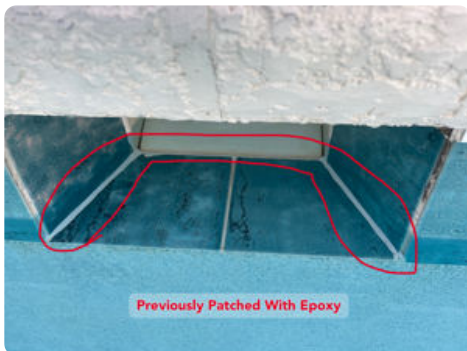

---

## Test - Pressure Test - Leak Detection

Pressure tested all lines.

## Test - Complete Dye Test

Performed a complete dye test in the pool.

---

## Miscellaneous

When specialist arrived on site. Air bubbles were exiting pool side. Specialist recommends consulting your pool service provider to service jandy/ pump to make sure all seals are good and tight. Air is entering through either pump or jandy valves. Result solar panels are allowing air to enter system. When off no bubbles.

