

# Invoice

Issued: 10/14/2021  
Due: 10/14/2021  
Pool Leak #227887

BILL TO  
**Florian Bergmann**  
3901 Ceitus Pkwy  
Cape Coral, FL 33991

JOB SITE  
**Florian Bergmann**  
3901 Ceitus Pkwy  
Cape Coral, FL 33991

BALANCE DUE  
**\$0.00**

DESCRIPTION OF WORK	QUANTITY	PRICE	TAX	TOTAL
<b>Residential Pool Leak Detection</b> <ul style="list-style-type: none"><li>Includes testing of the pool shell, plumbing lines and equipment</li><li>60 day warranty</li><li>If proper repairs are scheduled within 7 days of the initial leak detection, a \$100 scheduling discount will be applied to the repair invoice</li></ul> <i>Note: Bodies of water can lose up to a 1/4 inch a day from evaporation under normal operating conditions.</i> <i>Disclaimer: Fees for services will apply if water loss is due to evaporation.</i>	1.00	\$300.00	\$0.00	\$300.00
NO available method of pressure testing this line in the leak industry due to shape of the fountain - NO CHARGE!	1.00	\$0.00	\$0.00	\$0.00

Subtotal: **\$300.00**  
Tax: **\$0.00**

Payments: **\$300.00**

### Payment History


DATE	PAYMENT TYPE	STATUS	DESCRIPTION	NOTES	AMOUNT
Feb 15, 2024	Credit card charge	Declined	No description	No notes	<del>\$300.00</del>
Feb 15, 2024	Credit card charge	Paid	No description	No notes	\$300.00

📅 THURSDAY, OCTOBER 14, 2021

## Deck/Surface/Equipment

Description of deck and surface.

Deck: Tile Surface:blue gem Picture of pool equipment.

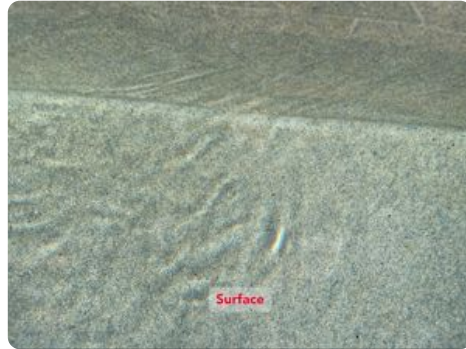

## Test - Pressure Test - Leak Detection

Pressure tested all lines. &nbsp;All lines appear to be holding solid.



## Pool - Skimmer - Throat

Found leak in skimmer throat where the plastic skimmer butts up to the cement pool shell. Area had been previously epoxied and the deterioration is now severe and over a quarter inch wide in some areas. Tried to Patch with epoxy but patch kept pulling into the gap. I do not expect this to hold. Expect minimal water loss until repairs are completed. Recommend skimmer throat rebuild. Using surface to replace the inner tiles as we will not be able to match the current tiles and using surface is the better repair.



---

## Test - Complete Dye Test

Performed a complete dye test in the pool.

---

## Pool - Sheer Descent (unable to test)

The sheer descent(s) CANNOT be tested because there is no way to plug off it's long, narrow opening.&nbsp;



## Leak Status - Minimal Water Loss

Minimal water loss should be expected until repairs are completed.&nbsp;  

---

## Miscellaneous

Surface is showing signs of deterioration.



## Problems - Light (unable to determine if it works)

Unable to determine if the light is working. The light switch was either not found or inaccessible.



## Warranties & Disclaimers

Payment is expected at time of service. License **#CPC1457457**

**Note:**

Customer is responsible for refilling water and balancing chemicals. Please monitor water levels for 48 hours. Contact RRLD with any questions or concerns.

**Change Order Disclaimer:**

A change order will be issued if RRLD discovers any unforeseen or unexpected work not specified above. An additional quote will be issued at that time.

**Deck Disclaimer:**

RRLD does not offer custom staining or textures. We will make every attempt to match the deck when applying deck patches. If an exact match is desired (color and texture), customer will need to hire a professional deck company to apply the patch.

**Patch Disclaimer:**

Red Rhino Leak Detection (RRLD) will make every attempt to match the existing surface when applying patches. However, due to variations of the product from the manufacturer and aging of the existing surface, it is impossible to achieve an exact match when patching. Refinishing the entire surface is the only way to ensure a consistent appearance without variation. Therefore, RRLD cannot be held responsible for color and texture variations which are unavoidable when patching.