

Invoice

Issued: 09/29/2021

Due: 09/29/2021

Pool Leak #228118

BILL TO	JOB SITE	BALANCE DUE
Beth Monsour 1905 S Holly Ln Tampa, FL 33629	Beth Monsour 1905 S Holly Ln Tampa, FL 33629	\$0.00

DESCRIPTION OF WORK	QUANTITY	PRICE	TAX	TOTAL
Residential Pool Leak Detection <ul style="list-style-type: none">Includes testing of the pool shell, plumbing lines and equipment60 day warrantyIf proper repairs are scheduled within 7 days of the initial leak detection, a \$100 scheduling discount will be applied to the repair invoice	1.00	\$300.00	\$0.00	\$300.00
<i>Note: Bodies of water can lose up to a 1/4 inch a day from evaporation under normal operating conditions.</i>				
<i>Disclaimer: Fees for services will apply if water loss is due to evaporation.</i>				
Discount	1.00	(\$150.00)	\$0.00	(\$150.00)

Subtotal:	\$150.00
Tax:	\$0.00
Payments:	\$150.00



Payment History

DATE	PAYMENT TYPE	STATUS	DESCRIPTION	NOTES	AMOUNT
Feb 15, 2024	Credit card charge	Paid	No description	No notes	\$150.00



The Pool Leak
Experts




WEDNESDAY, SEPTEMBER 29, 2021

Deck/Surface/Equipment

Description of deck and surface.

Deck: Travertine Pavers

Surface: Bone Gem Picture of pool equipment.

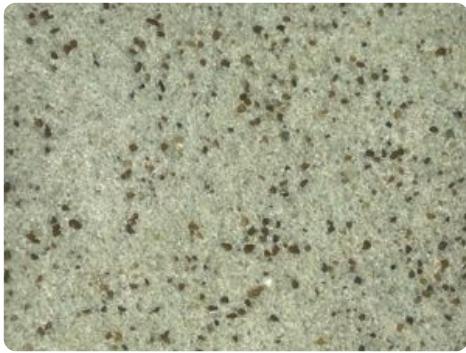

Equipment - Valve - Air Leak

Found air leak at valve. When pump is running, air is entering through the skimmer Jandy valve needs to be serviced. See picture for dysfunctional valve.



Equipment - Fitting - Air Leak

Found air leak at suction side elbow. When pump is running, air is entering the system through elbow. Fittings need to be replaced. See picture for dysfunctional fitting.



Test - Pressure Test - Leak Detection

Pressure tested all lines. All lines appear to be holding solid.



Pool - Return (around)

Found leak around pool return. Patched with epoxy. Recommend proper repair.



Pool - Skimmer - Throat

Found leak in skimmer throat where the plastic skimmer butts up to the cement pool shell. Patched with epoxy. Recommend proper repair.



Leak Status - Patched to Temporarily Prevent Water Loss

Epoxy was applied as a temporary patch to the leaking skimmer throat and pool return so that it can be ensured all leaks have been identified and all appropriate repairs have been quoted.

Warranties & Disclaimers

Payment is expected at time of service. License **#CPC1457457**

Note:

Customer is responsible for refilling water and balancing chemicals. Please monitor water levels for 48 hours. Contact RRLD with any questions or concerns.

Change Order Disclaimer:

A change order will be issued if RRLD discovers any unforeseen or unexpected work not specified above. An additional quote will be issued at that time.

Deck Disclaimer:

RRLD does not offer custom staining or textures. We will make every attempt to match the deck when applying deck patches. If an exact match is desired (color and texture), customer will need to hire a professional deck company to apply the patch.

Patch Disclaimer:

Red Rhino Leak Detection (RRLD) will make every attempt to match the existing surface when applying patches. However, due to variations of the product from the manufacturer and aging of the existing surface, it is impossible to achieve an exact match when patching. Refinishing the entire surface is the only way to ensure a consistent appearance without variation. Therefore, RRLD cannot be held responsible for color and texture variations which are unavoidable when patching.